


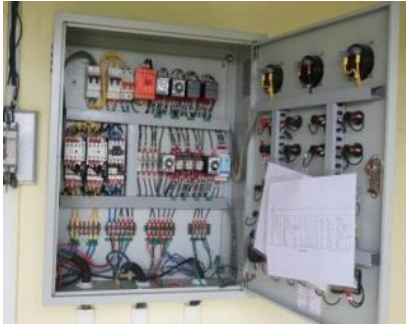






**Bi weekly Field Report**

**No. 24**









Surveyor Zaw La  
 Date visited 13 Sep 2018  
 Time visited 10:30 am











Weather Condition Cloudy  
 The last time of heavy raining Yesterday





No	Item	Condition	Narrative Description and Photos	
1	(1.1) Water Supply System	Improved <input type="checkbox"/> Same <input checked="" type="checkbox"/> * Worse <input type="checkbox"/> *as last week	<p><b><u>Narrative Description</u></b></p> <p>Water distribution system has been supporting ninety household of the zone B resettled families. Among many parts of the system, the ground tank need to do cleaning around once in twice month basic because the underground water includes iron hydroxide and yellowish mud that clogged in the iron removal tank.</p> <p><b><u>Photos</u></b></p>	
				
				
			<p>Water from ground water tank</p>	<p>Pipe line distribution water to houses</p>
				
				

No	Item	Condition	Narrative Description and Photos	
1	(1.2) Well	Improved <input type="checkbox"/> Same <input checked="" type="checkbox"/> * Worse <input type="checkbox"/> <i>*as last week</i>	<p>– Water from two open-wells is clean enough to use for drinking and living. There are eleven tube wells in the relocation site. Residents use the water basically from the pipeline distribution system so that the usage from the tube wells is quiet low. However, JET asked to inform if the tube wells are needed to repair.</p>	
			 <p data-bbox="560 719 984 770">Open Well No. 1</p>	 <p data-bbox="1007 719 1444 770">Open Well No. 2</p>
			 <p data-bbox="560 1106 984 1128">Tube Well No. 1</p>	 <p data-bbox="1007 1106 1444 1128">Tube Well No. 2</p>
			 <p data-bbox="560 1464 984 1487">Tube Well No. 3</p>	 <p data-bbox="1007 1464 1444 1487">Tube Well No. 4</p>
			 <p data-bbox="560 1823 984 1830">Tube Well No. 5</p>	 <p data-bbox="1007 1823 1444 1830">Tube Well No. 10</p>



			 <p>Tube Well No.11</p>	 <p>Tube Well No.7</p>
(2) Drainage	Improved <input type="checkbox"/> Same <input checked="" type="checkbox"/> * Worse <input type="checkbox"/> <i>*as last week</i>	<p>– There is a little amount of water in the drainage canals at the moment.</p> <p><b>Photos</b></p>	 <p>The drain at the corner of Main Road A and B</p>	 <p>The exit of the drain at the corner of Site village road and 2<sup>nd</sup> street</p>
			 <p>The exit of the drain at the corner of Site village road and 3<sup>rd</sup> street</p>	 <p>The exit of the drain at the corner of Site village road and Main Road C</p>
(3) Road	Improved <input type="checkbox"/> Same <input checked="" type="checkbox"/> * Worse <input type="checkbox"/> <i>*as last week</i>	<p>– All the roads are getting wet but no problem for walking except from road no. 1 where some mud are deposited and it is needed to be careful to walk across on it.</p> <p><b>Photos</b></p>	 <p>Main Road - B</p>	 <p>1<sup>st</sup> Street</p>

			 <p>2<sup>nd</sup> Street Upper</p>	 <p>2<sup>nd</sup> Street Lower</p>
			 <p>3<sup>rd</sup> Street Upper</p>	 <p>3<sup>rd</sup> Street Lower</p>
			 <p>4<sup>th</sup> Street Upper</p>	 <p>4<sup>th</sup> Street Lower</p>
			 <p>5<sup>th</sup> Street</p>	 <p>6<sup>th</sup> Street</p>
			 <p>7<sup>th</sup> Street</p>	 <p>Site Village Road</p>

	(4) Garbage Condition	Improved <input type="checkbox"/> Same <input checked="" type="checkbox"/> * Worse <input type="checkbox"/> <i>*as last week</i>	<ul style="list-style-type: none"> <li>- The rubbishes have been dumped beside the creek and even in front of the houses before the enough garbage bins are provided.</li> <li>- Total of fourteen garbage bins have been provided and placed at the corner of each road until the end of April. In the meantime, all the garbage bins are kept by the community leader of PAPs in the communal compound near the triangle junction of Main Road C and Upper Fourth Street. So, the garbage will be kept in the house until the garbage truck comes and collects during the raining season.</li> </ul> <p><b>Photos</b></p>
			<div style="display: flex; justify-content: space-around;"> <div style="text-align: center;">  <p>Rubbishes in the creek near 1st street</p> </div> <div style="text-align: center;">  <p>Rubbishes in the creek near 2nd street</p> </div> </div>
			<div style="display: flex; justify-content: space-around;"> <div style="text-align: center;">  <p>Rubbishes in the creek near Main Road C</p> </div> <div style="text-align: center;">  <p>Rubbishes in the creek near 6<sup>th</sup> Street</p> </div> </div>



(5) Fly proof toilet

Improved   
 Same \*  
 Worse   
 \*as last week

- All of the fly proof toilets are used the residents.
- All of the toilets are repaired by the following procedures;
  - Installation the extra septic tanks beside the original
  - The pipe line system is installed from the extra tank to the ditch to flow the liquid out.

The toilet renovation plan was successfully done and there is no problem at the moment.

Condition	No. of HHs	
	This week condition	Previous week condition
Level 1	91	91
Level 2	0	0
Level 3	0	0
Level 4	0	0
No Toilet	0	0

**<Evaluation Criteria>**

**Level 1**

- Fly proof toilet is not needed to be repaired.
- No/rarely toilet unavailable

**Level 2**

- Fly proof toilet is needed to be repaired.
- Rarely toilet unavailable

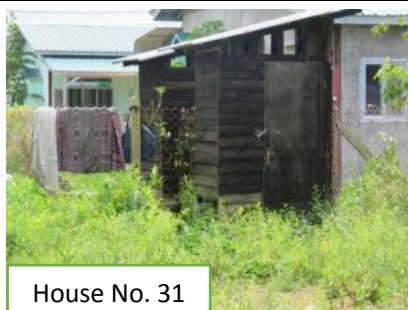
**Level 3**







- Fly proof toilet is needed to be repaired.
- Often toilet unavailable
- As the result of filling the soil and also due to the heavy rain, some toilets are inconvenience to use.

**Level 4**

- Fly proof toilet is urgently needed to be repaired.
- Often toilet unavailable

**Photos**



	(6) Electricity	Improved <input type="checkbox"/> Same <input checked="" type="checkbox"/> * Worse <input type="checkbox"/> <i>*as last week</i>	<ul style="list-style-type: none"> <li>– Residents get the electricity regularly.</li> <li>– Electric poles and transformer are being supported with the good foundations.</li> <li>– There are some pieces of wood under an electric pole of main road B and it's needed to clean up.</li> </ul> <p><b>Photos</b></p>	
			 <p>Transformer No. 1</p>	 <p>Transformer No. 2</p>
			 <p>Transformer No. 3</p>	 <p>Electric poles of Main Road B and Main Road C</p>
No	Item	Condition	Description and Photos	
2	(1)House Construction	No. of houses which are not completed (4)	<ul style="list-style-type: none"> <li>– In plot No.9 and 10, three houses that are planned to build as the plots are owned by father and son. Construction has been finished for two houses and one house is not finished yet.</li> <li>– Plot No.64, the house construction seems to be stopped.</li> <li>– Plot No.78, the house construction is needed to be carried on, however PAPs are living now.</li> <li>– Plot No. 66, the house construction for the first floor has been finished and the second floor is still needed to be carried on.</li> </ul> <p><b>Photos</b></p>  <p>House No. 9</p>  <p>House No. 64</p>	



**3 Other Issues**

(1). Drainage condition for rain water in the compounds

Description

Condition	No. of HHs	
	This week condition	Previous week condition
Level 1	85	85
Level 2	3	3
Level 3	2	2
Level 4	1	1

**<Evaluation Criteria>**

**Level 1**

-No mud and no standing water with their own drainage system in their compound

**Level 2**

-No mud and no standing water in their compound

**Level 3**

- Some or little mud and standing water in their compound

**Level 4**

-A lot of mud and standing water in their compound

**Photos**







(2) Plantation

- In front of the compounds, the shady trees, fruit trees, flowering plants and vegetables are being planted.



Description

- In front of the compounds, the shade trees, fruit trees, ~~flora~~ flowering plants and vegetables are being planted.

Type	No. of HHS	Remarks
Shade tree	15	Albizzia, Indian almond, Neem tree, etc. HH No. 20, 40, 43, 48, 51, 57, 59, 61, 62, 67, 69, 72, 73, 77, 85
Fruit tree	37	Banana, Mango, sugar cane, coconut, citrus and jack fruit etc. HH No. 3, 15, 17, 20,21, 23, 28, 30, 31, 32, 34, 37, 40, 41, 48, 51, 52, 55, 57, 58, 59, 61, 62, 63, 67, 68, 70, 71, 72, 73, 77, 78, 82, 85, 86, 88
Vegetables	20	Chili, tomato, bitter gourd, Roselle, gourd, basils, eggplant etc. HH No. 12, 17, 21, 41, 49, 58, 59, 61, 62, 63, 67, 68, 70, 71, 72, 73, 77, 82, 85, 86
Flowering plant	31	Jasmine, poinsettia, orchid, kiss me quick, etc. HH No. 3, 5, 6, 8, 10, 12, 13, 14, 17, 20, 21, 22, 23, 29, 30, 31, 32, 46, 48, 58, 59, 61, 62, 65, 67, 68, 69, 72, 77, 78, 86

Photos



(3) Livestocks	<p><b>Description</b> -The chicken, geese and ducks are being raised.</p> <table border="1" data-bbox="571 165 1193 342"> <thead> <tr> <th>Type</th> <th>No. of HHs</th> <th>Remarks</th> </tr> </thead> <tbody> <tr> <td>Chicken</td> <td>6</td> <td>HH No. 13, 14, 21, 59, 67, 78</td> </tr> <tr> <td>Duck</td> <td>3</td> <td>HH No.12</td> </tr> <tr> <td>Goose</td> <td>2</td> <td>HH No. 40, 67</td> </tr> </tbody> </table>	Type	No. of HHs	Remarks	Chicken	6	HH No. 13, 14, 21, 59, 67, 78	Duck	3	HH No.12	Goose	2	HH No. 40, 67
	Type	No. of HHs	Remarks										
Chicken	6	HH No. 13, 14, 21, 59, 67, 78											
Duck	3	HH No.12											
Goose	2	HH No. 40, 67											
	<p><b>Photos</b></p> <div style="display: flex; justify-content: space-around;"> <div data-bbox="587 506 995 815">  <p>House No. 67</p> </div> <div data-bbox="1023 506 1431 815">  <p>House No. 12</p> </div> </div>												